

TECHNICAL BULLETIN

LP419-001V2

12 MAY 2006



© Jaguar Land Rover Limited
All rights reserved.

This reissue replaces all previous versions. Please destroy all previous versions. Only refer to the electronic version of this Technical Bulletin in TOPIx.

This bulletin supersedes TSB LP419-001/2006 dated 27 JAN 2006, which should either be destroyed or clearly marked to show it is no longer valid (e.g. with a line across the page). Only refer to the electronic version of this Technical Bulletin in TOPIx.

SECTION: 419-01 (86 - Alarm System and Horn)

Range Rover (LP) - Battery Loses Charge Overnight

AFFECTED VEHICLE RANGE:

Range Rover (LP)

MARKETS:

All

CONDITION SUMMARY:

Situation:

A customer may report a concern that the vehicle battery loses charge overnight.

This bulletin has been re-issued to include all markets and add a part number.

Cause: The body electronic control module (BeCM) picks up stray radio frequency signals, preventing the module from maintaining standby/power-save mode.

Action: Should a customer express concern regarding the above, refer to the Service Instruction detailed in this bulletin to renew the alarm receiver.

PARTS:

YWY500170	Alarm receiver - 433MHZ	Quantity: 1
YWY500200	Alarm receiver - 315MHZ	Quantity: 1

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME	CONDITION CODE	CAUSAL PART
Receiver - alarm system - renew	86.77.31	0.10 hours	C8	ASR1953

 **NOTE: Normal Warranty policies and procedures apply.**

SERVICE INSTRUCTION:

1. Renew the alarm receiver. For additional information, refer to Range Rover (LP) Workshop Manual Section 86, Electrical, Repair, Receiver (86.77.31).