

84 WIPERS AND WASHERS

NEW RANGE ROVER

WASHER RESERVOIR


Service repair no - 84.10.01

Remove


1. Raise the vehicle.

WARNING: Support on safety stands.


2. Remove RH wheel arch liner. **See CHASSIS AND BODY, Repair.**
3. Remove bolt and screw securing filler neck to chassis and radiator bracket.

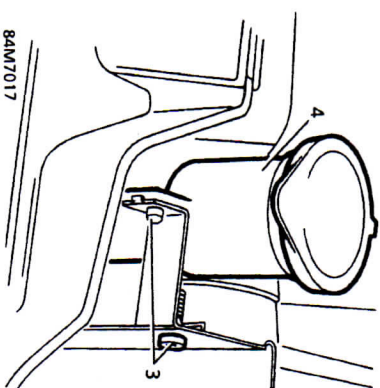

4. Remove filler neck.
5. Remove 2 bolts securing reservoir to chassis.

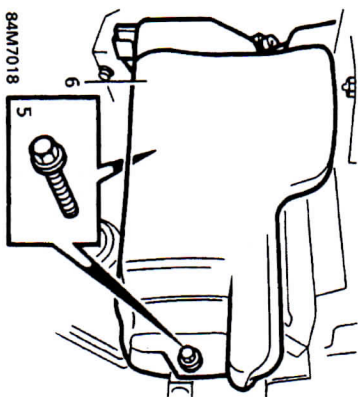

6. Release reservoir from mounting for access to washer pumps.
7. Disconnect multiplugs and hoses from 3 washer pumps.

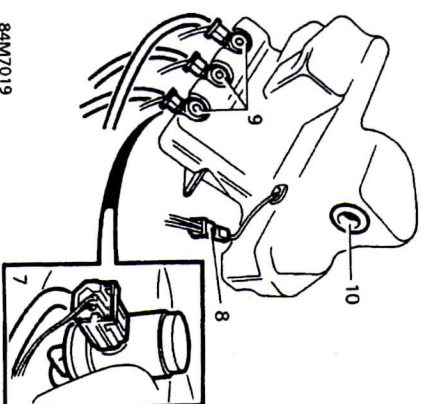

8. Disconnect liquid level indicator multiplug.
9. Remove washer pumps and seals from reservoir.
10. Remove filler neck seal.

Refit

11. Reverse removal procedure.


WIPERS AND WASHERS

FRONT WIPER ARM

Service repair no - 84.15.01 - Pair
Service repair no - 84.15.02 - Each

Remove

1. Remove cover from wiper arm nut.

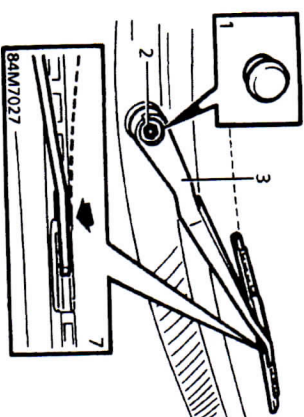

2. Remove nut securing wiper arm to spindle.
3. Remove wiper armblade assembly.
4. If necessary, release clip and remove blade from wiper arm.

Refit


5. If necessary, fit blade to wiper arm.
6. Ensure motor is in "park" position.
7. Position wiper armblade assembly. Ensure tip of wiper arm is level with top edge of screen obscuration band.
8. Secure wiper arm with nut. Tighten to 19 Nm. (14 lbf.ft)
9. Lift wiper arm slightly. Remove pin.
10. Fit cover to wiper arm nut.
11. Operate wipers on wet screen to ensure correct setting.

FRONT WIPER BLADE

Service repair no - 84.15.05 - Pair
Service repair no - 84.15.06 - Each

Remove

1. Raise wiper arm.
2. Release clip securing blade to wiper arm.

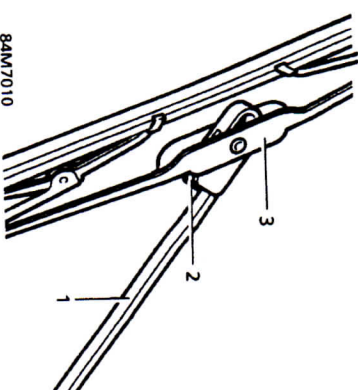

3. Remove wiper blade.

Refit

4. Position blade. Push into arm until clip engages in slot.
5. Lower wiper arm.