

PUBLISHED: 11-MAY-2011  
2011.0 RANGE ROVER (LM), 303-01A

ENGINE – TDV8 4.4L DIESEL

# OIL COOLER (G1346501)

## REMOVAL


 NOTES:

- Some variation in the illustrations may occur, but the essential information is always correct.
- Removal steps in this procedure may contain installation details.

1. Disconnect the battery ground cable.

Refer to: [Specifications](#) (414-01 Battery, Mounting and Cables, Specifications).


- 2.

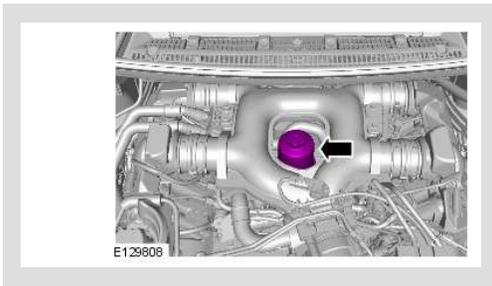


- Loosen the oil filter cover 3 turns and allow the engine oil to drain.

3. Refer to: [Intake Manifold Plenum Chamber](#) (303-01A Engine - TDV8 4.4L Diesel, Removal and Installation).

- 4.

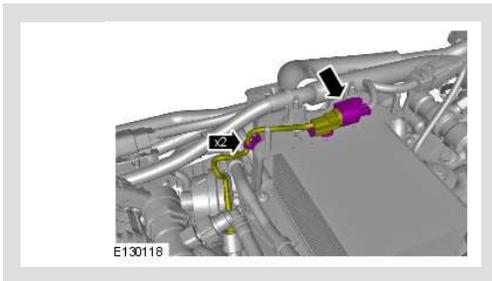

5.

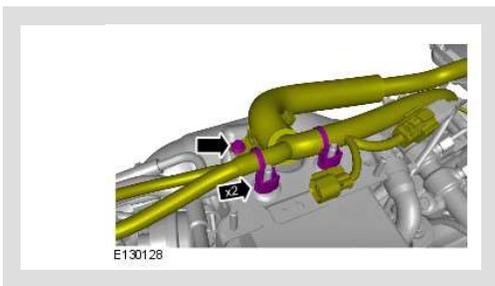


*Torque: 10 Nm*

6.


**⚠ CAUTION:**

Make sure that all openings are sealed. Use new blanking caps.

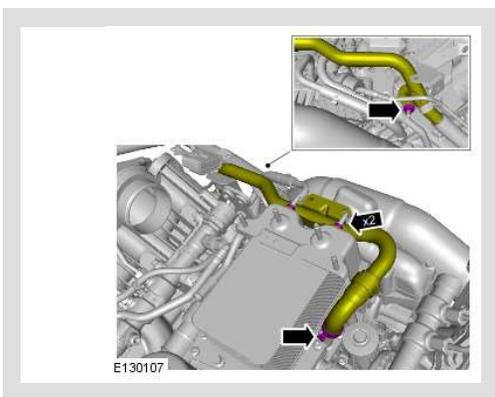

*Torque: 10 Nm*

7.

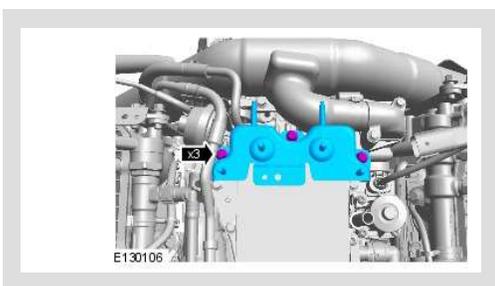


*Torque: 10 Nm*

8.

**ⓘ CAUTIONS:**

- Be prepared to collect escaping oil.
- Make sure that all openings are sealed. Use new blanking caps.

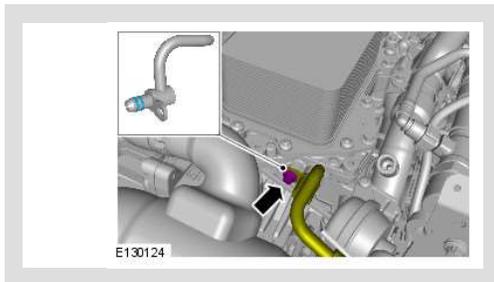


*Torque: 10 Nm*

9.

**ⓘ CAUTIONS:**

- Be prepared to collect escaping oil.
- Be prepared to collect escaping coolant.
- Make sure that the mating faces are clean and free of foreign material.
- Make sure the seal is installed correctly.

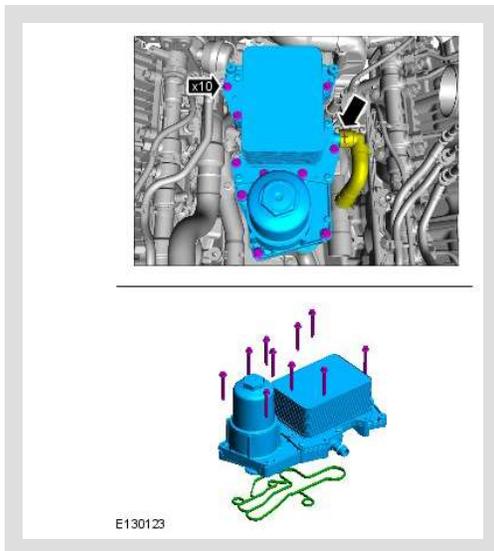

*Torque: 13 Nm*

**INSTALLATION**

1. To install, reverse the removal procedure.

