


# C3070R : Engine compartment harness to engine harness

## Connector Face

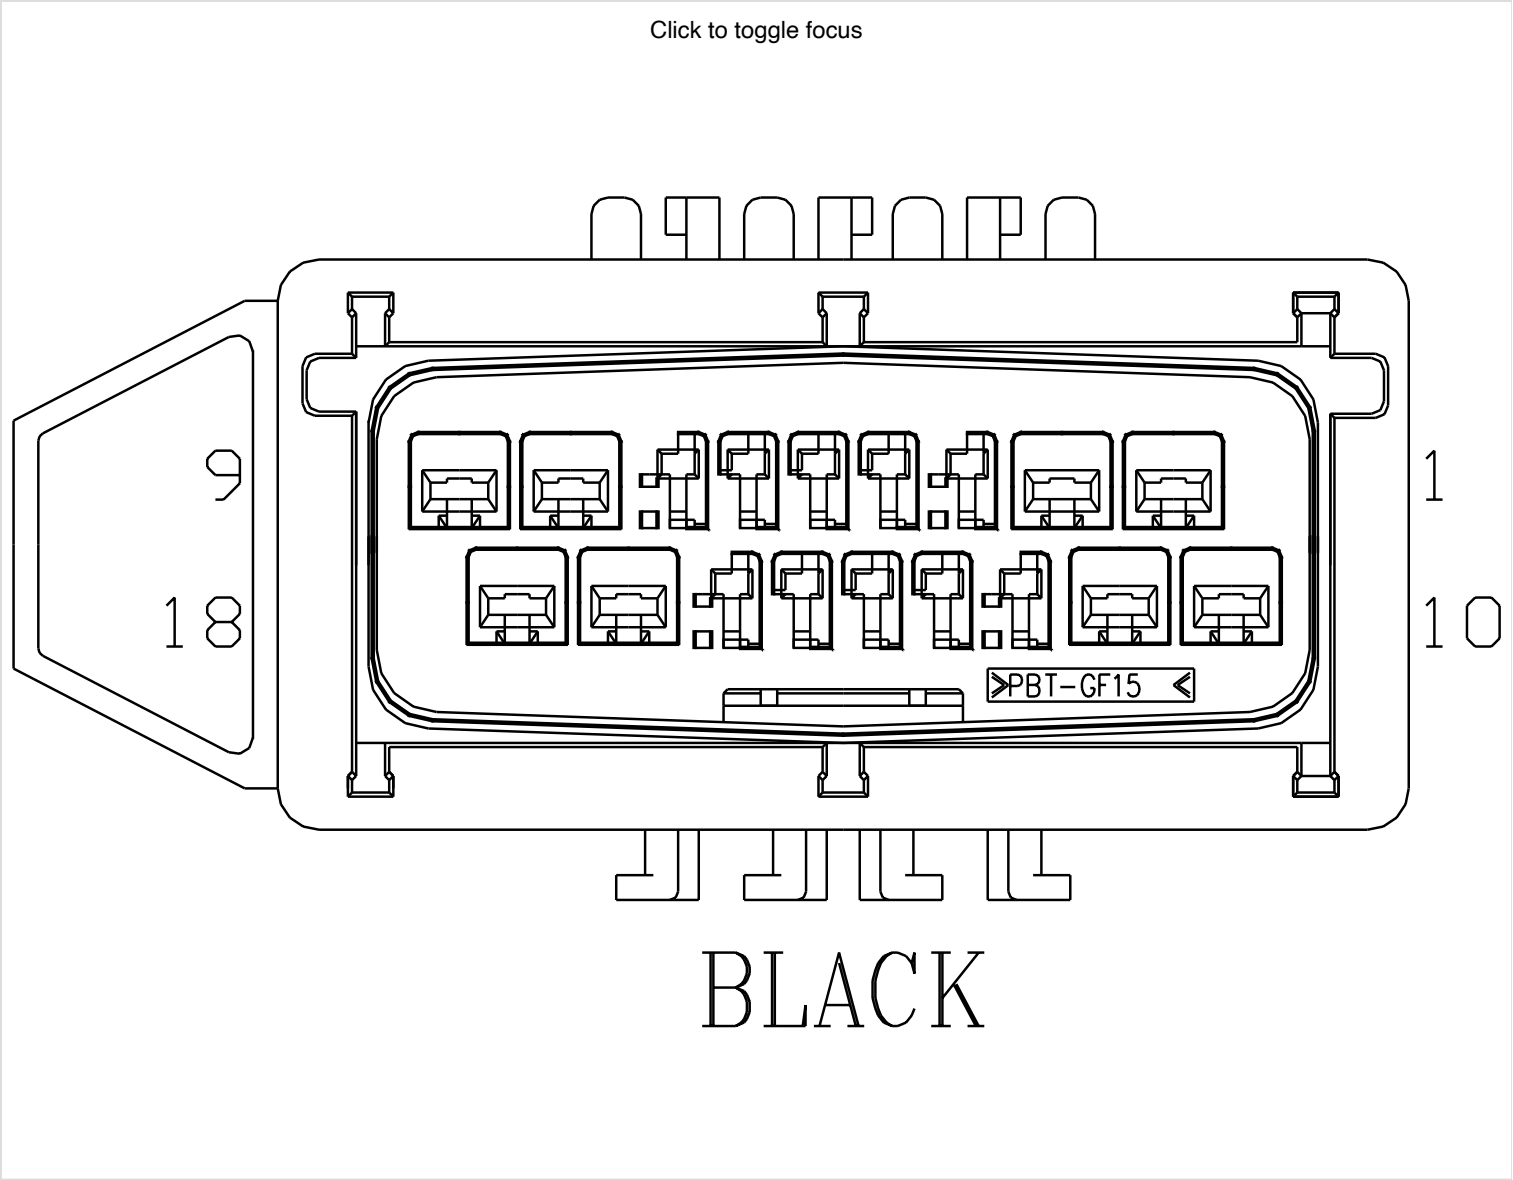

## Housing

Serviceable

## Engineering Part Number

YPC909600

## Service Part Number

YPC909600

## Colour

BLACK

## Cavities

18

## Harness

ENGINE COMPARTMENT HARNESS

## Description


Engine compartment harness to engine harness

## Location

Rear LH side of engine compartment

Qualifier

RHD condition illustrated

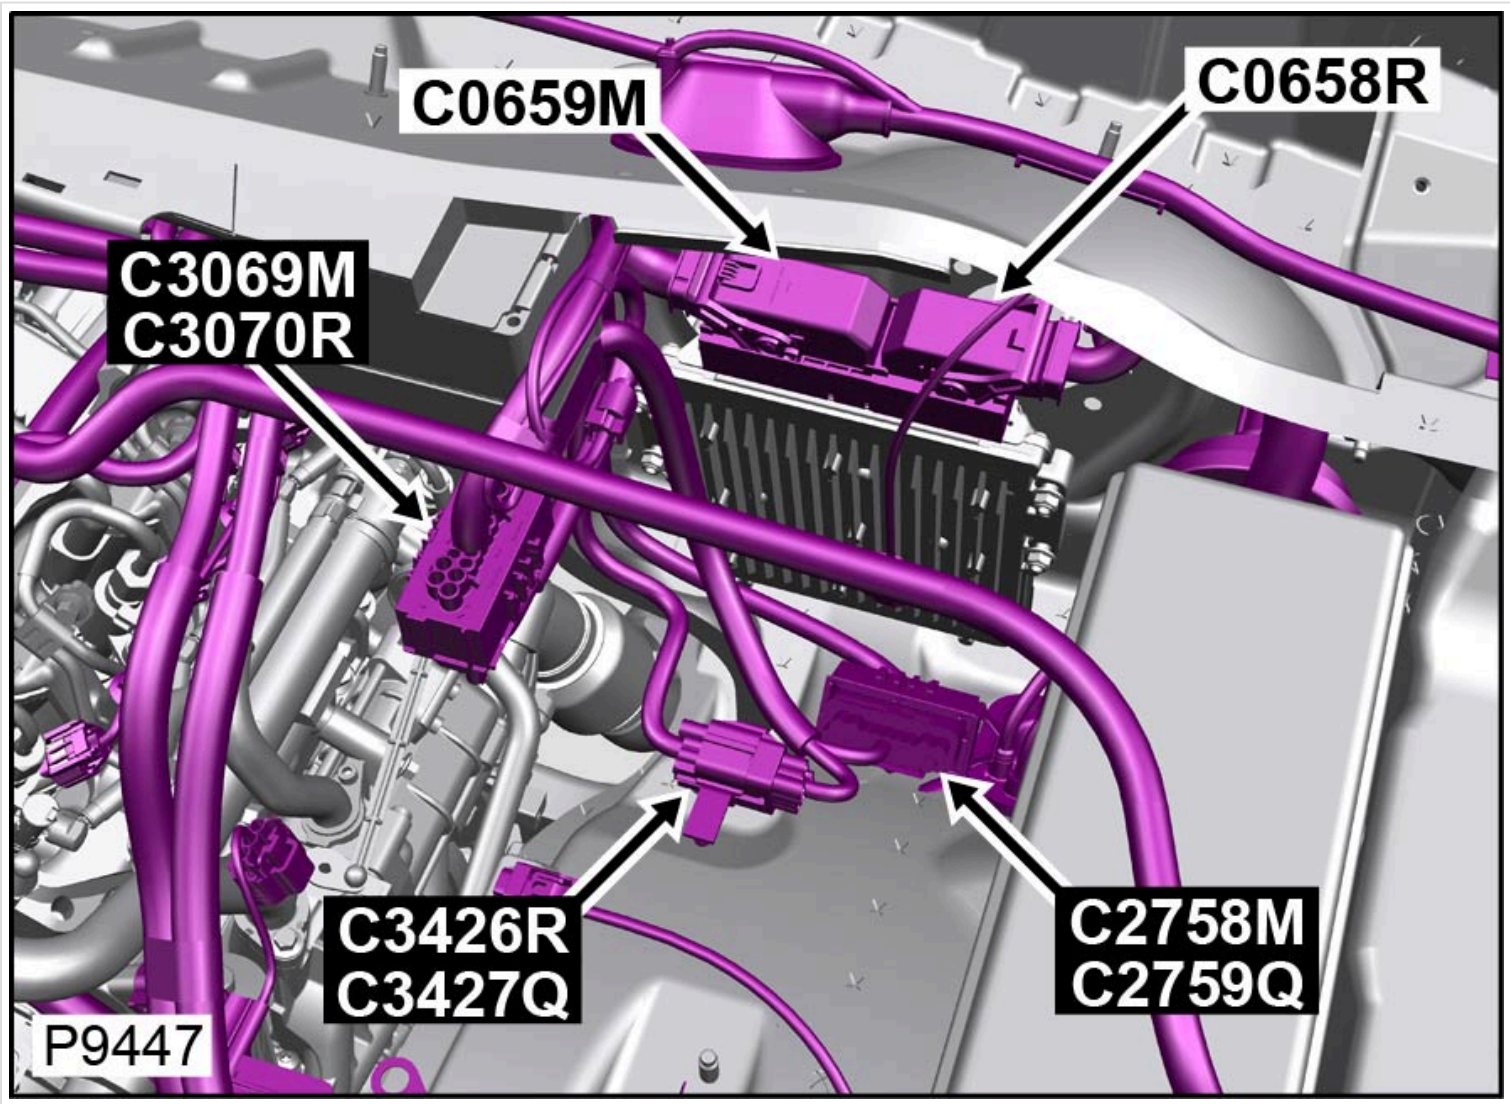

Connector

C3427Q

C3070R

C0658R

C2759Q

Wire chart and service repair kit information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	R	798R	C0570R	418-411-19	418-664	418-116A	418-672	418-104	418-113	418-108
2	0.5	BG	798R	SJ1865	418-411-73	418-595	418-116A	418-672	418-104	418-112	418-107
3	0.5	YG	798R	C0658R	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
4	0.5	UN	798R	C2244R	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
5	0.5	SO	1097R	C0570R	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
6	0.5	OG	1097R	C2181R	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
8	1.5	WR	17	C0570R	418-411-19	418-664	418-116A	418-672	418-104	418-113	418-108
9	0.5	WN	798R	C2240R	418-411-73	418-595	418-116A	418-672	418-104	418-112	418-107
10	0.75	BN	798R	SJ630	418-411-73	418-595	418-116A	418-672	418-104	418-112	418-107
11	0.5	OY	798R	SJ1864	418-411-73	418-595	418-116A	418-672	418-104	418-112	418-107
12	0.75	RU	798R	SJ511	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
14	1.0	U	798R	SJ1933	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
16	0.75	S	798R	C0584R	418-411-09	418-595	418-116A	418-672	418-104	418-112	418-107
17	0.5	YS	798R	C2240R	418-411-73	418-595	418-116A	418-672	418-104	418-112	418-107
18	2.5	R	1097R	C0570R	418-411-19	418-664	418-116A	418-672	418-104	418-113	418-108